

# Mounting instruction

**ECOFLEX®7**

SMA-RP Connector, screw/solder / Art. No. 7381



- 1.** Cut off cable tail right-angled. Move the nut, clamping ring and rubber washer over the cable head.  
Hint: With a bit of Vaseline the rubber seal can be slid easier over the outer sheath.



- 4.** Remove the copper foil and the foamed dielectric just at the contact sleeve.



- 2.** Remove 4.5 mm of the outer sheathing with a knife.



- 5.** Put the inner pin with the thread onto the inner conductor and solder it.



- 3.** Bend copper braid upwards right-angled. Slide the contact sleeve as far it goes between the copper braid and the foil and remove the exceed copper braid with a side cutter..



- 6.** Insert the so prepared cable end into the connector housing. Hand tighten the clamping nut with two 13mm open-end wrenches and screw the contact onto the thread of the inner pin..